

flashing: Standby mode or program function object detected solid: object in evaluation range flashing: program function solid: object in detection range flashing: program function solid: temperature/program plug not connected flashing: fault or program function object not detected Temperature compensation, Evaluation range programming , output function setting 10 ... 30 V DC , ripple 10 %SS ≤ 900 mW RS 232, 9600 Bit/s , no parity, 8 data bits, 1 stop bit bi-directional 0 level -U_B...+1 V 1 level: +4 V...+U_B input impedance: > 12 KOhm synchronization pulse: \geq 100 µs, synchronization interpulse period: $\geq 2 \text{ ms}$ ≤ 30 Hz ≤ 30 Hz / n , n = number of sensors , n ≤ 5 1 current output 4 ... 20 mA 1 voltage output 0 ... 10 V evaluation range [mm]/4000, but ≥ 0.35 mm < 0.2 % of full-scale value ≤ 0.1 % of full-scale value current output: ≤ 500 Ohm Voltage output: ≥ 1000 Ohm ≤ 2 % from full-scale value (with temperature compensation) ≤ 0.2 %/K (without temperature compensation) 0 ... 70 °C (32 ... 158 °F) -40 ... 85 °C (-40 ... 185 °F) Connector M12 x 1 , 5-pin IP65 Stainless steel 1,4305 / AISI 303 O-ring for cover seal: Viton PTFE (diaphragm surface) 170 a evaluation limit A1: 100 mm evaluation limit A2: 1000 mm rising ramp EN 60947-5-2:2007+A1:2012 IEC 60947-5-2:2007 + A1:2012 EN 60947-5-7:2003 IEC 60947-5-7:2003

Date of issue: 2016-11-04 Release date: 2016-11-04 11:38

120335_eng.xml

Refer to "General Notes Relating to Pepperl+Fuchs Product Information"

Pepperl+Fuchs Group www.pepperl-fuchs.com

USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com


Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com






1

Dimensions

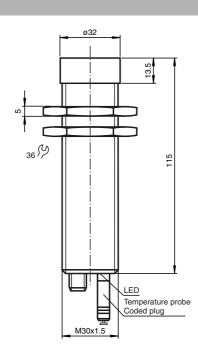

Electrical Connection



Core colors in accordance with EN 60947-5-2.

Pinout

Connector V15



Accessories

BF 30 Mounting flange, 30 mm

BF 30-F Mounting flange with dead stop, 30 mm UC-30GM-PROG

ULTRA3000 Software for ultrasonic sensors, comfort line UC-30GM-R2

DA5-IU-2K-V Process control and indication equipment

V15-G-2M-PVC Female cordset, M12, 5-pin, PVC cable

Description of Sensor Functions

Pepperl+Fuchs Group www.pepperl-fuchs.com

2


Refer to "General Notes Relating to Pepperl+Fuchs Product Information". USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com

Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com

Additional Information

Programmed analogue output function

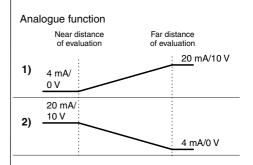



Programming procedure

The sensor features 2 programmable analog outputs with programmable evaluation range. Programming the evaluation range and the operating mode is done either via the sensor's RS232 interface and ULTRA3000 software (see the ULTRA3000 software description) or by means of the programming plug at the sensor's back end which is described here.

Programming of Evaluation Range

- 1. Disconnect supply voltage
- 2. Remove the programming plug to activate program mode.
- 3. Reconnect supply voltage (Reset)
- 4. Place the target at the desired position for A1
- 5. Momentarily insert the programming plug in position A1 and then remove. This will program the position A1.
- 6. Place the target at the desired position for A2
- 7. Momentarily insert the programming plug in position A2 and then remove. This will program the position A2.

Notes:

- · Removing the programming plug saves the new position into the device memory.
- The programming status is indicated by the LED. A flashing green LED indicates that the target is detected; a flashing red LED indicates that no target is detected.

Programming the Operation Mode

- If the program mode is still activated, continue at number 4. If not, activate program mode by performing the sequence numbers 1 to 3.
- 1. Disconnect supply voltage
- 2. Remove the programming plug to activate program mode.
- 3. Reconnect supply voltage (Reset)
- 4. Insert the programming plug in position E2/E3. By removing and reinserting the plug, the user can toggle through the three different modes of operation. The selected mode is indicated by the LEDs as shown below:
 - Rising slope mode, LED A2 flashes
 - Falling slope mode, LED A1 flashes
 - Zero line mode, LEDs A1 and A2 flash
- 5. Once the desired mode is selected, insert the programming plug in position T. This completes the programming procedure and saves the switch points and mode of operation.
- 6. The sensor now operates in normal mode.

Note:

The programming plug also functions as the temperature compensation. If the programming plug has not been inserted in the T position within 5 minutes, the sensor will return to normal operating mode with the latest saved values, without temperature compensation.


Factory settings

See technical data.

Display

The sensor provides LEDs to indicate various conditions.

	Green LED	Red LED	Yellow LED A1	Yellow LED A2
During Normal Operation				
 Temperature compensated 	On	Off	Object in evaluation range	Object in sensing range
 with removed programming plug 	Off	On	Object in evaluation range	Object in sensing range
Interference (e.g. compressed air)	Off	Flashing	remains in previous state	remains in previous state
During Sensor Programming				
Evaluation limit A1:				
Object detected	Flashing	Off	Flashing	Off
No object detected	Off	Flashing	Flashing	Off
Evaluation limit A2:		_		
Object detected	Flashing	Off	Off	Flashing
No object detected	Off	Flashing	Off	Flashing
Operation mode:		_		-
Rising slope mode	On	Off	Off	Flashing
Falling slope mode	On	Off	Flashing	Off
Zero line mode	On	Off	Flashing	Flashing
Standby	Flashing	Off	remains in previous state	remains in previous state




Synchronization

www.pepperl-fuchs.com

This sensor features a synchronization input for suppressing ultrasonic mutual interference ("cross talk"). If this input is not connected, the sensor will operate using internally generated clock pulses. It can be synchronized by applying an external square wave. The pulse duration must be \geq 100 µs. Each falling edge of the synchronization pulse triggers transmission of a single ultrasonic pulse. If the synchronization signal remains low for \geq 1 second, the sensor will revert to normal operating mode. Normal operating mode can also be activated by opening the signal connection to the synchronization input (see note below).

If the synchronization input goes to a high level for > 1 second, the sensor will switch to standby mode, indicated by the green LED. In this mode, the outputs will remain in the last valid output state.




USA: +1 330 486 0001 fa-info@us.pepperl-fuchs.com

486 0001 Germany: + erl-fuchs.com fa-info@de.p

Germany: +49 621 776 4411 fa-info@de.pepperl-fuchs.com Singapore: +65 6779 9091 fa-info@sg.pepperl-fuchs.com



3



Note:

If the option for synchronization is not used, the synchronization input has to be connected to ground (0 V) or the sensor must be operated via a V1 cordset (4-pin).

The synchronization function cannot be activated during programming mode and vice versa.

The following synchronization modes are possible:

- 1. Several sensors (max. number see technical data) can be synchronized together by interconnecting their respective synchronization inputs. In this case, each sensor alternately transmits ultrasonic pulses in a self multiplexing mode. No two sensors will transmit pulses at the same time (see note below).
- 2. Multiple sensors can be controlled by the same external synchronization signal. In this mode the sensors are triggered in parallel and are synchronized by a common external synchronization pulse.
- 3. A separate synchronization pulse can be sent to each individual sensor. In this mode the sensors operate in external multiplex mode (see note below).
- 4. A high level (+U_B) on the synchronization input switches the sensor to standby mode.

Note:

Sensor response times will increase proportionally to the number of sensors that are in the synchronization string. This is a result of the multiplexing of the ultrasonic transmit and receive signal and the resulting increase in the measurement cycle time.

Note on communication with the UC-30GM-R2 interface cable

The UC-30GM-R2 interface cable allows for communication with the ultrasonic sensor using ULTRA3000 software. The cable creates a connection between a PC RS-232 interface and the programming plug socket on the sensor. When connecting to the sensor, make certain the plug is lined up correctly; otherwise no communication will be possible. The key of the cable's plug must be aligned to the groove of the socket on the sensor (not with the arrow symbol on the sensor).



- Evaluation limits A1 and A2
- Operation mode
- Sonic speed
- Temperature offset (The inherent temperature-rise of the sensor can be considered in the temperature compensation)
- Expansion of the unusable area (for suppression of unusable area echoes)
- · Reduction of the detection range (for suppression of remote range echoes)
- Time of measuring cycle
- · Acoustic power (interference of the burst duration)
- Sensitivity
- Behavior of the sensor in case of echo loss
- Behavior of the sensor in case of a fault
- · Average formation via an allowed number of measuring cycles
- · Selection of the parameter set, RS 232 or manually

Note:

When connected to a PC and running the ULTRA3000 software, the sensor can act as a long term data logger as well.

Installation conditions

If the sensor is installed in an environment where the temperature can fall below 0 °C, one of these mounting flanges must be used for mounting: BF30, BF30-F, or BF 5-30.

If the sensor is mounted in a through hole using the included steel nuts, it must be mounted at the middle of the threaded housing. If it must be mounted at the front end of the threaded housing, plastic nuts with centering ring (optional accessories) must be used.

